
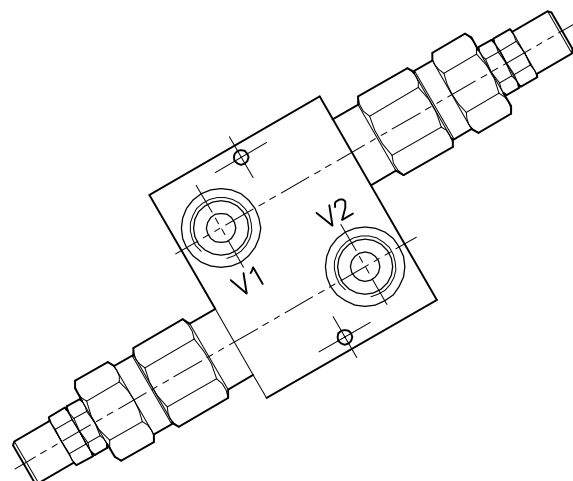


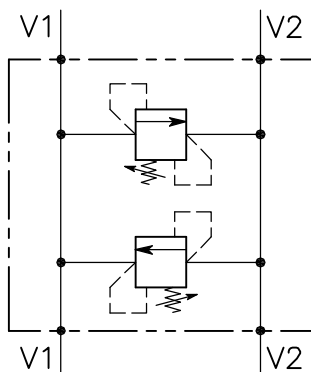


CARATTERISTICHE


Luce nominale min/max	DN 8/10
Portata min/max	1/80 l/min - 0.26/21 GPM
Pressione di lavoro max.	350 bar - 5075 PSI
Pressione max. di taratura	350 bar - 5075 PSI
Temperatura ambiente	-30°C + 50°C
Temperatura olio	-30°C + 80°C
Filtraggio consigliato	30 micron
Coppia di serraggio	70÷85 Nm
Peso 3/8" GAS	0.882 Kg
Peso 3/4" GAS	1.582 Kg

PERFORMANCE


Min/max rated size
Min/max flow-rate
Max working pressure
Max setting pressure
Room temperature
Oil temperature
Recommended filtration
Tightening torque
Weight 3/8" GAS
Weight 3/4" GAS

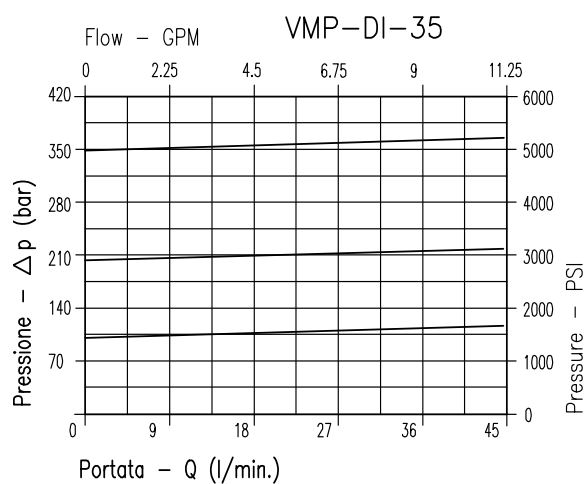

Viscosità olio 46 cSt a 50°C
Oil viscosity 46 cSt at 50°C

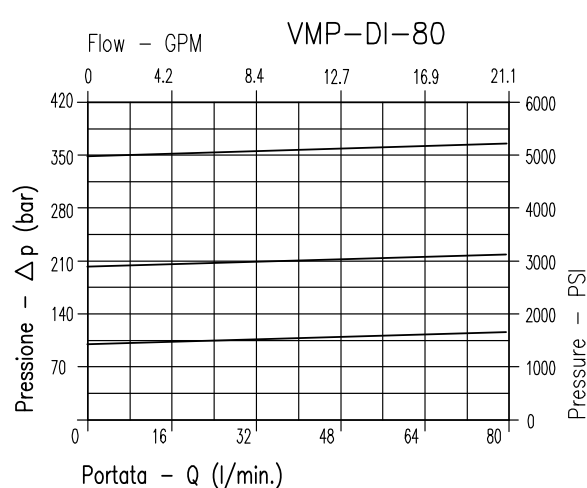

Viscosità olio 46 cSt a 50°C
Oil viscosity 46 cSt at 50°C

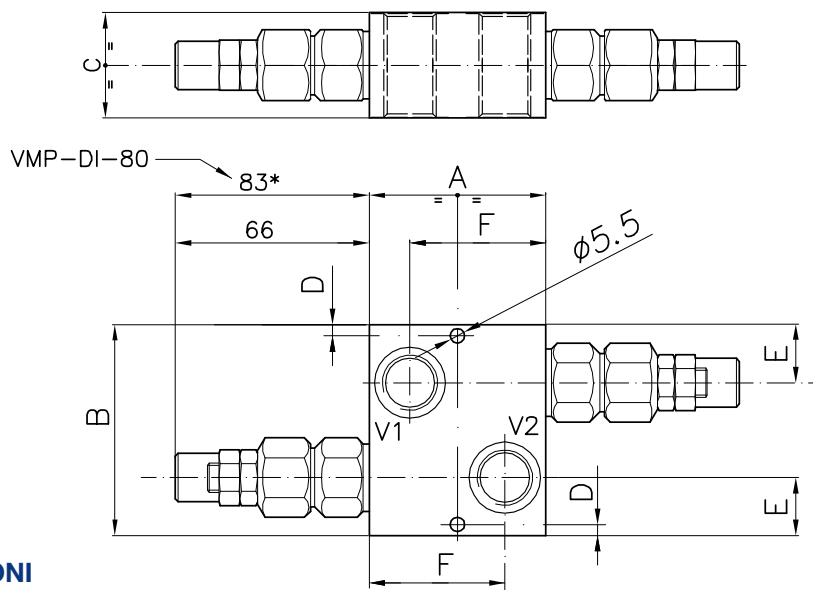

DIMENSIONI DIMENSIONS

Campo taratura Setting range			A	B	C	D	E	F	Attacchi Port size V1-V2 GAS (BSPP)
051	281	282	80	60	40	5.5	18	64	3/8"
052	283	284							1/2"

Campo taratura Setting range					A	B	C	D	E	F	Attacchi Port size V1-V2 GAS (BSPP)
053	285	286	287	288	80	60	40	5.5	18	64	3/4"
				332							3/4"

CODICE DI ORDINAZIONE HOW TO ORDER

Campo taratura / Setting range		
051	281	282
052	283	284
Campo taratura 5÷100 bar (molla colore blu) Setting range 5÷100 bar (blue spring)	Campo taratura 10÷210 bar (molla colore verde) Setting range 10÷210 bar (green spring)	Campo taratura 20÷350 bar (molla colore giallo) Setting range 20÷350 bar (yellow spring)
Taratura standard (Q=5 l/1')	Taratura standard (Q=5 l/1')	Taratura standard (Q=5 l/1')
Incr. press. - bar giro/vite	Incr. press. - bar giro/vite	Incr. press. - bar giro/vite
Std. bar setting (Q=5 l/1')	Std. bar setting (Q=5 l/1')	Std. bar setting (Q=5 l/1')
Pressure rise - turn of screw	Pressure rise - turn of screw	Pressure rise - turn of screw
80 bar	180 bar	320 bar
(--)	(--)	(--)

002 051 0 X 0 . A

Campo taratura / Setting range					Materiale collettore Body material
053	285	286	287	288	
				332	Acciaio zincato Zinc plated steel
Campo taratura 5÷50 bar (molla colore blu) Setting range 5÷50 bar (colour blue spring)	Campo taratura 5÷100 bar (molla colore nero) Setting range 5÷100 bar (colour black spring)	Campo taratura 10÷150 bar (molla colore verde) Setting range 10÷150 bar (colour green spring)	Campo taratura 25÷250 bar (molla colore giallo) Setting range 25÷250 bar (colour yellow spring)	Campo taratura 40÷350 bar (molla colore rosso) Setting range 40÷350 bar (colour red spring)	
Taratura standard (Q=5 l/1')	Taratura standard (Q=5 l/1')	Taratura standard (Q=5 l/1')	Taratura standard (Q=5 l/1')	Taratura standard (Q=5 l/1')	
Incr. press. - bar giro/vite	Incr. press. - bar giro/vite	Incr. press. - bar giro/vite	Incr. press. - bar giro/vite	Incr. press. - bar giro/vite	
Std. bar setting (Q=5 l/1')	Std. bar setting (Q=5 l/1')	Std. bar setting (Q=5 l/1')	Std. bar setting (Q=5 l/1')	Std. bar setting (Q=5 l/1')	
Pressure rise - turn of screw	Pressure rise - turn of screw	Pressure rise - turn of screw	Pressure rise - turn of screw	Pressure rise - turn of screw	
40 bar	80 bar	120 bar	210 bar	320 bar	
(--)	(--)	(--)	(--)	(--)	